



## TSB - CAS03

Models applicable > Case/New Holland CX50,60,70,80,90,100  
Ag Clutch Part Number > 331 1002 CA-DCB  
CLUTCH PLATE REPLACEMENT

The clutch plate hub clearance in the flywheel must be checked prior to the installation of the clutch.

The inner flywheel rebate dimension must be at least 190mm diameter x 6mm in depth. If not, the flywheel must be modified to allow the correct hub clearance of the new upgraded disc.

Failure to check and or modify the flywheel may result in release problems, clutch shudder or premature disc failure.

### THRUST BEARING REPLACEMENT

Ag Clutch recommends this bearing and sleeve assembly be replaced EVERYTIME the clutch is renewed.

Ag Clutch Part Number > AGTB6140 (includes sleeve)



The part number above includes a special plastic sleeve, this is pressed into the bearing and is designed to reduce the wear and heat that would otherwise be transferred through the clutch diaphragm.

The total thickness of the thrust bearing & thrust washer = 26mm

### LEADING BRANDS

