

## TSB - MF05

Models applicable > Massey MF298,398,399,575,698,699 MF4245,4255,4270

Details > with 330mm (Split > Torque) cover assembly FLYWHEEL RESTORATION / COVER COMPATIBILITY Ag Clutch Part Numbers >





133 2512 MF

(with locating lip)

(no cover locating lip)

Check flywheel spigot to establish the correct replacement cover assembly. The cover is specially designed to suit the respective flywheel.

WITH LOCATING LIP > The cover has an internal locating spigot which locates in a rebate of the flywheel.

## Flywheel Machining >

When fitting Part no > 130 2512 MF-L or 133 2513 MF the flywheel must be restored to original whenever new clutch is fitted. The outer rebate must be restored to no less than 3mm in depth to establish the correct cover location.

NO LOCATING LIP > The cover has an external locating spigot which locates against the outer wall of the flywheel.

## Flywheel Machining >

When fitting Part no > 130 2512 MF the flywheel must be restored to original whenever new clutch is fitted. The outer wall spigot must remain at approximately 3mm in height to establish the correct cover location.

Note > Mix matching of covers causes release problems and/or premature failure of clutch.

## LEADING BRANDS













