




## TSB - FW03

Models applicable > Fiat > 160-90,180-90,1580,1880  
Massey > 3680,3690


Details > when fitted with 310mm twin plate cover assembly  
Ag Clutch Part Numbers > 631 3105 FI and 631 3101 MF

### FLYWHEEL MACHINING and CLUTCH KIT REPLACEMENT

Ag Clutch recommends complete clutch kit replacement and correct restoration or renewal of the flywheel.

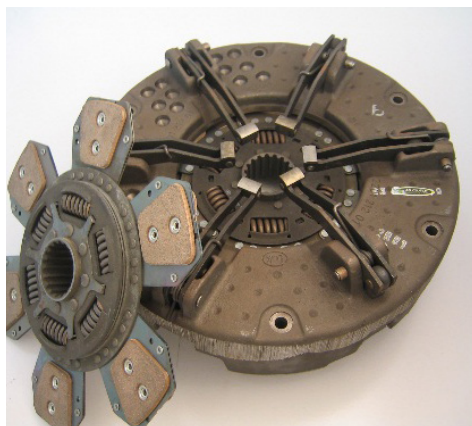

631 3105 FI

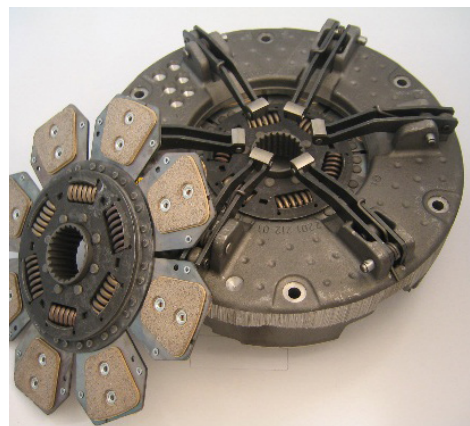

631 3101 MF

The flywheel step must be restored to the original FLAT condition (cover OD locating spigot = 362mm diameter)

In the above applications the cover is designed to release the clutch plates simultaneously, allowing even torque transfer and consistent engagement.

Severe flywheel wear is quite common due to the use of ceramic discs - if the flywheel is not restored to original condition this can simulate a worn flywheel side disc, therefore changing the lever height.

This causes the flywheel side disc to release prematurely resulting in rapid disc wear and ultimately cover assembly and clutch failure.

The clutch is factory set to suit original component specifications only.

Ag Clutch will not accept any responsibility for any loss or damage caused as a direct result of the flywheel not having been restored to original specification.

#### LEADING BRANDS

