




## TSB - CAS02

Models applicable > Case 745S,844S,743XL,745XL,844XL,845XL  
Ag Clutch Part Number > 329 1001 CA-DCB

### CLUTCH PLATE REPLACEMENT

The clutch plate hub recess in the flywheel must be checked prior to installation of the clutch.

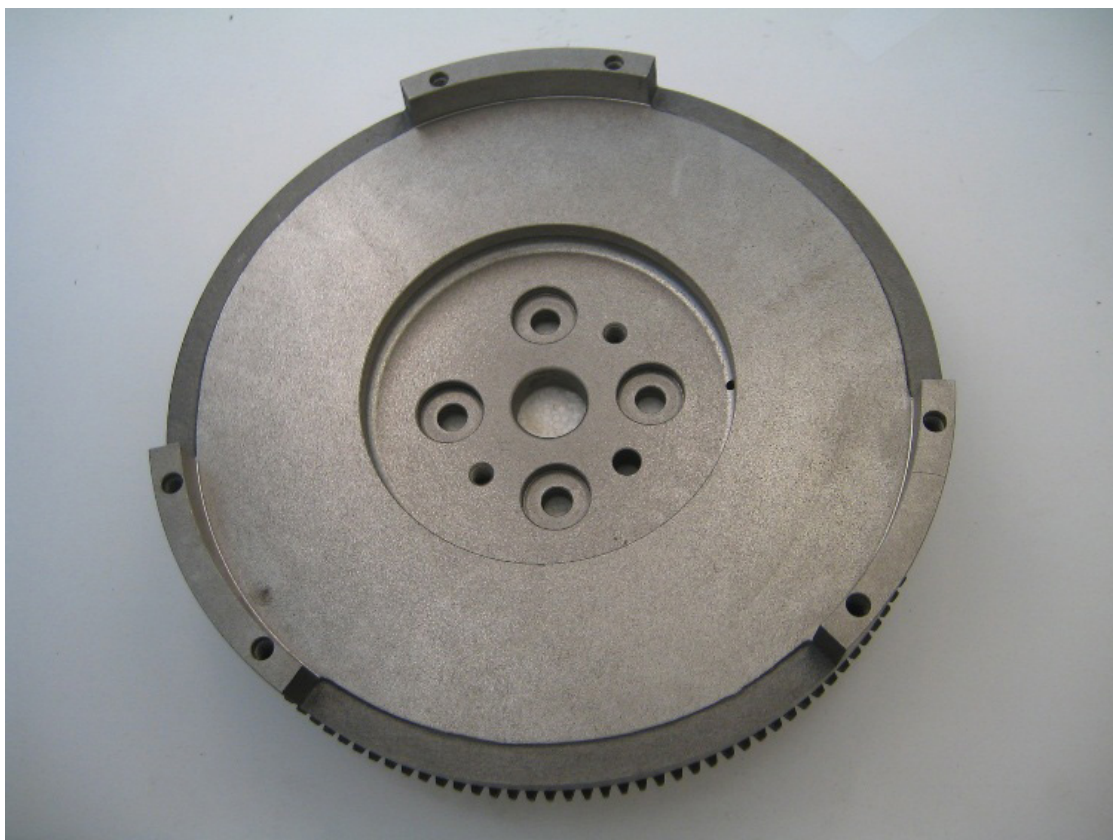

The flywheel rebate dimension in some models is only 165mm in diameter.

This must be increased to 170mm diameter X 3mm deep to allow clearance of the larger hub of the upgraded disc.

Failure to check and/or modify the flywheel may result in release problems, possible shudder or premature disc failure.

#### LEADING BRANDS



[australianclutch.com.au](http://australianclutch.com.au)

1800 CLUTCH (258824)